

# **CHEROKEE NATION**

## **Environmental Programs**



### **Lead-Based Paint Inspection Report**

**PARTICIPANT:** DAVIS, DEBORAH

**PREPARED BY:** LOGAN GIRTY, ENVIRONMENTAL SPECIALIST II

**REQUESTED BY:** CHEROKEE NATION COMMERCE DEPARTMENT (HUD)-  
CALLIE BENOIT

## I. GENERAL INFORMATION

---

DATE OF INSPECTION: June 1, 2022

### PARTICIPANT INFO:

Deborah Davis  
918-869-1443  
6193 N 38<sup>th</sup> St E, Ft. Gibson, OK 74434  
Coordinates: 35.8306, -95.3186  
Year of home construction: 1974

### INSPECTOR INFORMATION

Logan Girty, Environmental Specialist 1  
Cherokee Nation Environmental Programs  
PO Box 948, Tahlequah, OK 74465  
(918) 772-8346  
Oklahoma Inspector/Risk Assessor, OKRASR13908  
Cherokee Nation Inspector/Risk Assessor, CNRASR00037

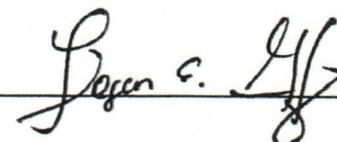
Cherokee Nation Environmental Programs  
PO Box 948, Tahlequah, OK 74465  
(918) 453-5009  
Oklahoma Firm: OKFIRM11198  
Cherokee Nation Firm: CNFIRM00001

### EQUIPMENT INFORMATION

XRF Lead Paint Analyzer  
Manufacturer: Viken Detection  
Model #: Pb200i  
Serial Number: 3177  
Radioactive Source: Cobalt 57  
Sourced Date: 2/15/2022

This site has passed visual inspection. Lead-based paint was found; however the paint condition is intact and is not a hazard at this time. Recommended participant remove or replace closet door. Please see section 2 for more information.

Inspector  
Signature:

 \_\_\_\_\_ Date: 6.1.22

Viken Detection  
 Pb200i  
 XRF Lead Paint Analyzer  
 3177  
 Pb200i-5.2.0

Reading #	Pb	Units	Pb	Error	Result	Secs	Date	Time	Room	Structure	Member	Substrate	Wall Condition	
1	1.03	mg/cm <sup>2</sup>	0.07			20.26	6/1/2022	12:23:57	Calibration					
2	1	mg/cm <sup>2</sup>	0.07			20.13	6/1/2022	12:24:36	Calibration					
3	0.99	mg/cm <sup>2</sup>	0.07			20.18	6/1/2022	12:25:15	Calibration					
4	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:39:33	Living/Kitchen Room	Wall	Wood	A	Intact	
5	0.1	mg/cm <sup>2</sup>	0.3	Negative		2	6/1/2022	13:39:43	Living/Kitchen Room	Wall	Wood	B	Intact	
6	0.1	mg/cm <sup>2</sup>	0.3	Negative		2	6/1/2022	13:39:54	Living/Kitchen Room	Wall	Wood	C	Intact	
7	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:40:13	Living/Kitchen Room	Ceiling	Drywall		Intact	
8	0	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:40:38	Living/Kitchen Room	Baseboard	Wood	A	Intact	
9	0.1	mg/cm <sup>2</sup>	0.3	Negative		2	6/1/2022	13:41:05	Living/Kitchen Window	Sill	Wood	A	Intact	
10	10.3	mg/cm <sup>2</sup>	0.3	Positive		2	6/1/2022	13:41:24	Living/Kitchen Door	Wood	C	Intact		
11	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:41:29	Living/Kitchen Door	Casing	Wood	C	Intact	
12	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:42:04	Living/Kitchen Door		Wood	A	Intact	
13	0.1	mg/cm <sup>2</sup>	0.3	Negative		2	6/1/2022	13:42:20	Living/Kitchen Door	Casing	Wood	A	Intact	
14	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:43:07	Living/Kitchen Cabinets	Door	Wood	B	Intact	
15	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:43:13	Living/Kitchen Cabinets	Frame	Wood	B	Intact	
16	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:43:48	Bedroom 1	Room	Wood	A	Intact	
17	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:43:58	Bedroom 1	Room	Wood	B	Intact	
18	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:44:10	Bedroom 1	Room	Wood	C	Intact	
19	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:44:21	Bedroom 1	Room	Wood	D	Intact	
20	0	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:44:37	Bedroom 1	Ceiling	Wood		Intact	
21	0.1	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:44:56	Bedroom 1	Window	Wood	A	Intact	
22	0	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:45:12	Bedroom 1	Door	Wood	D	Intact	
23	0	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:45:20	Bedroom 1	Door	Casing	Wood	D	Intact
24	0	mg/cm <sup>2</sup>	0.2	Negative		2	6/1/2022	13:46:10	Living Room	Door	Wood	D	Intact	
25	0	mg/cm <sup>2</sup>	0.3	Negative		2	6/1/2022	13:46:37	Living Room	Door	Casing	Wood	D	Intact

26	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:47:38	Bathroom 1	Room	Wall	Wood	Wood	Wood	A	Intact
27	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:47:46	Bathroom 1	Room	Wall	Wood	Wood	Wood	B	Intact
28	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:47:54	Bathroom 1	Room	Wall	Wood	Wood	Wood	C	Intact
29	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:48:02	Bathroom 1	Room	Wall	Wood	Wood	Wood	D	Intact
30	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:48:16	Bathroom 1	Room	Ceiling	Drywall	Drywall	Drywall	D	Intact
31	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:48:38	Bathroom 1	Room	Baseboard	Wood	Wood	Wood	D	Intact
32	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:48:55	Bathroom 1	Cabinets	Door	Wood	Wood	Wood	A	Intact
33	0 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:49:01	Bathroom 1	Cabinets	Frame	Wood	Wood	Wood	A	Intact
34	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:49:15	Bathroom 1	Door	Wood	Wood	Wood	Wood	D	Intact
35	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:49:30	Bathroom 1	Door	Casing	Wood	Wood	Wood	D	Intact
36	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:50:08	Bedroom 2	Room	Wall	Wood	Wood	Wood	A	Intact
37	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:50:18	Bedroom 2	Room	Wall	Wood	Wood	Wood	B	Intact
38	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:50:27	Bedroom 2	Room	Wall	Wood	Wood	Wood	C	Intact
39	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:50:47	Bedroom 2	Room	Window	Wood	Wood	Wood	D	Intact
40	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:51:16	Bedroom 2	Room	Ceiling	Drywall	Drywall	Drywall	D	Intact
41	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:51:33	Bedroom 2	Room	Baseboard	Wood	Wood	Wood	A	Intact
42	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:51:56	Bedroom 2	Window	Sill	Wood	Wood	Wood	C	Intact
43	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:52:20	Bedroom 2	Door	Casing	Wood	Wood	Wood	A	Intact
44	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:52:27	Bedroom 2	Door	Wall	Wood	Wood	Wood	A	Intact
45	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:53:01	Bedroom 3	Room	Wall	Wood	Wood	Wood	A	Intact
46	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:53:11	Bedroom 3	Room	Wall	Wood	Wood	Wood	B	Intact
47	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:53:18	Bedroom 3	Room	Wall	Wood	Wood	Wood	C	Intact
48	0 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:53:38	Bedroom 3	Room	Window	Wood	Wood	Wood	D	Intact
49	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:53:58	Bedroom 3	Door	Casing	Wood	Wood	Wood	C	Intact
50	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:54:27	Bedroom 3	Door	Wall	Wood	Wood	Wood	A	Intact
51	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:54:43	Bedroom 3	Door	Casing	Wood	Wood	Wood	A	Intact
52	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:54:51	Bedroom 3	Door	Wall	Wood	Wood	Wood	A	Intact
53	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:55:24	Bedroom 4	Room	Wall	Wood	Wood	Wood	A	Intact
54	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:55:31	Bedroom 4	Room	Wall	Wood	Wood	Wood	B	Intact
55	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:55:41	Bedroom 4	Room	Window	Wood	Wood	Wood	C	Intact
56	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:55:51	Bedroom 4	Room	Wall	Wood	Wood	Wood	D	Intact
57	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:56:09	Bedroom 4	Room	Ceiling	Drywall	Drywall	Drywall	D	Intact
58	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:56:32	Bedroom 4	Window	Sill	Wood	Wood	Wood	D	Intact
59	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:56:48	Bedroom 4	Door	Door	Wood	Wood	Wood	B	Intact

60	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:57:01	Bedroom 4	Door	Casing	Wood	B	Intact
61	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:57:44	Exterior	Door	Wood	A	Intact	
62	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:57:51	Exterior	Door	Wood	A	Intact	
63	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:58:17	Exterior	Soffit	Wood	A	Intact	
64	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:58:25	Exterior	Fascia	Wood	A	Intact	
65	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:58:49	Exterior	Room	Wall	Wood	A	Intact
66	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:58:57	Exterior	Window	Sill	Wood	A	Intact
67	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	13:59:49	Garage	Door	Casing	Metal	A	Intact
68	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	13:59:57	Garage	Door	Wood	Wood	A	Intact
69	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:00:49	Exterior	Room	Wood	Wood	B	Intact
70	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:01:18	Exterior	Soffit	Wood	Wood	B	Intact
71	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:01:25	Exterior	Fascia	Wood	Wood	B	Intact
72	0.1 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:01:38	Exterior	Room	Wall	Wood	C	Intact
73	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:01:46	Exterior	Soffit	Wood	Wood	C	Intact
74	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:01:52	Exterior	Fascia	Wood	Wood	C	Intact
75	0 mg/cm <sup>2</sup>	0.2 Negative	2	6/1/2022	14:03:09	Exterior	Soffit	Wood	Wood	D	Intact
76	0.1 mg/cm <sup>2</sup>	0.3 Negative	2	6/1/2022	14:03:16	Exterior	Fascia	Wood	Wood	D	Intact
77	1.03 mg/cm <sup>2</sup>	0.07	20.11	6/1/2022	14:04:37	Calibration					
78	1.02 mg/cm <sup>2</sup>	0.07	20.27	6/1/2022	14:05:16	Calibration					
79	1.02 mg/cm <sup>2</sup>	0.07	20.18	6/1/2022	14:05:56	Calibration					